



Repairing Dolce Gusto Melody Water Seal

Showing how to repair the leaking water from the bottom of the machine caused by a dirty water seal near the bottom of the water tank.

Written By: abc



INTRODUCTION

A friend of mine had some issues with leaking water from the machine. So, we decided to try to repair it. With success :-)



TOOLS:

- [TR10 Torx Security Screwdriver](#) (1)



PARTS:

- [MS-0907124 - Krups Seal](#) (1)

Step 1 — Repairing Dolce Gusto Melody Water Seal





- ❗ Be sure to unplug the device before you begin the procedure.
- Remove the 6 screws from the back.

Step 2



- Gently pull at the top of the rear cover.

Step 3

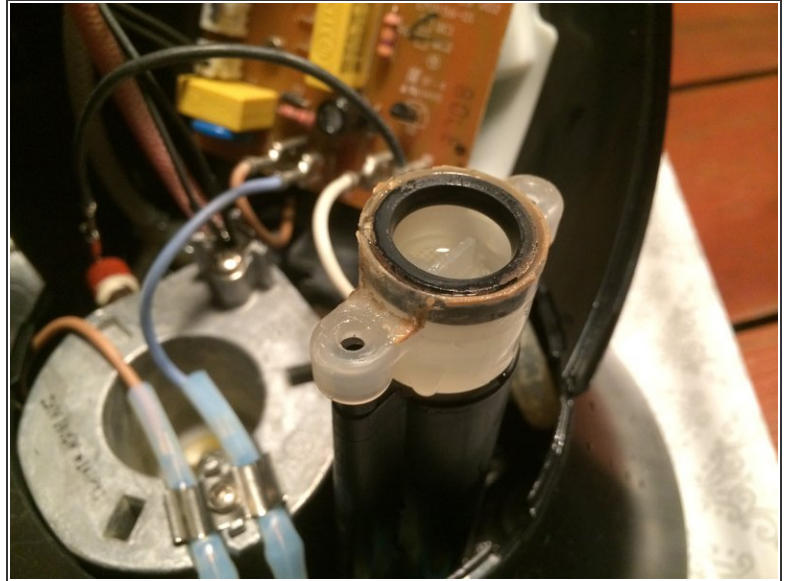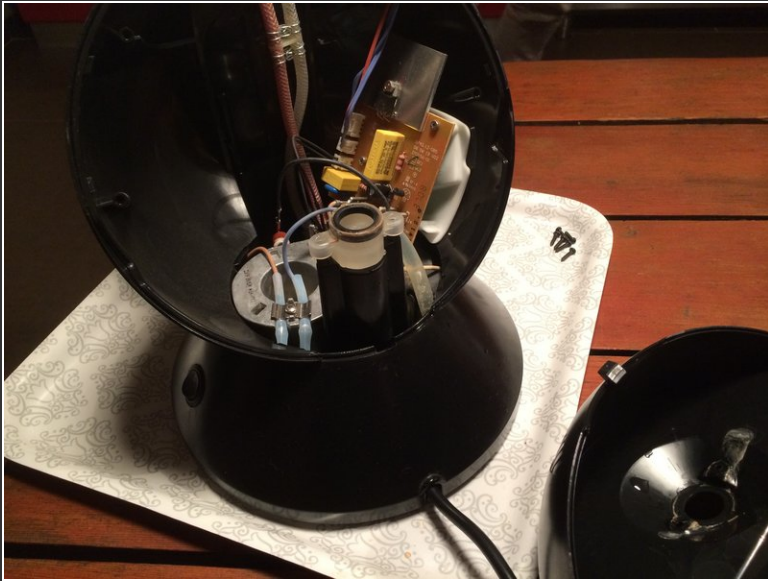

- Locate the dirty seal inside

Step 4




- Pull out the rubber seal and the filter.

Step 5




- Clean the inside of the cover, the rubber ring, the filter and the holder of the rubber and filter.

Step 6

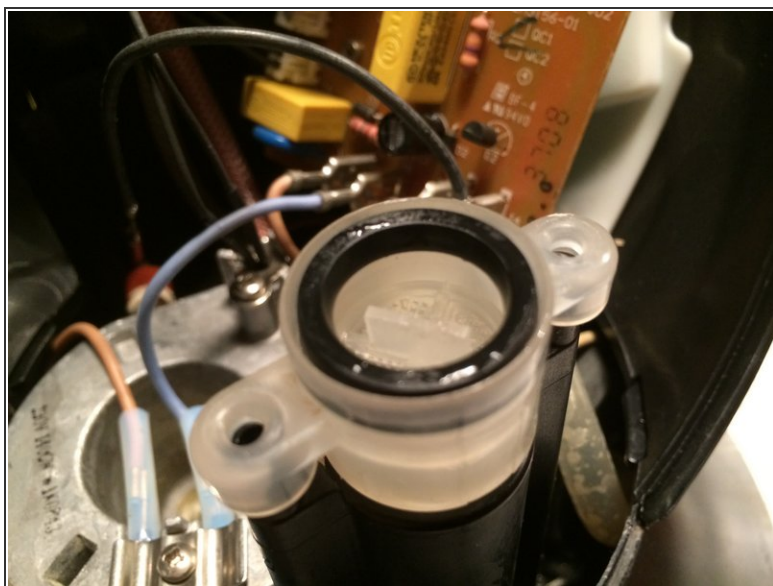


- Put it all back together... First the filter, then the rubber ring... You need the smooth side of the ring facing up.

Step 7

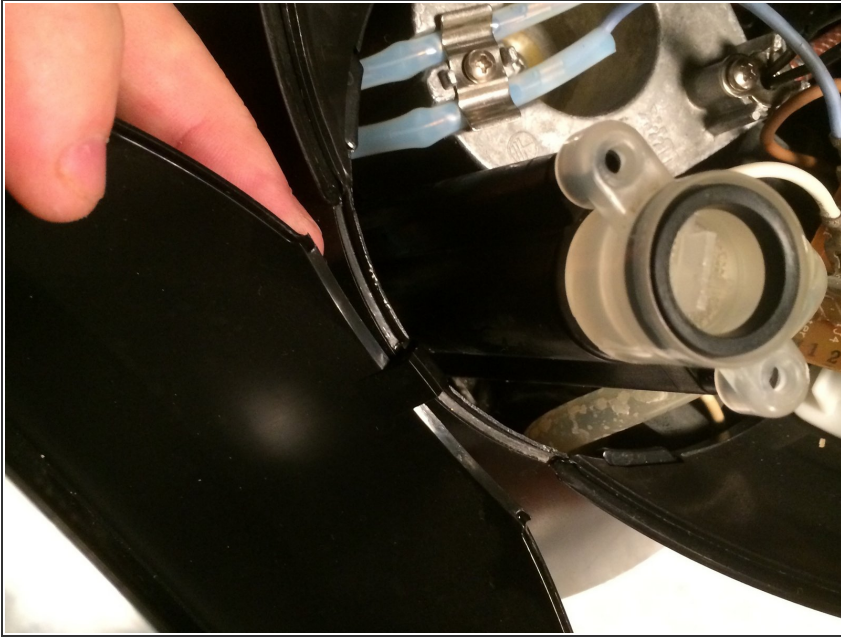

- Hook back in the back cover, be careful not to break the clip at the bottom

Step 8

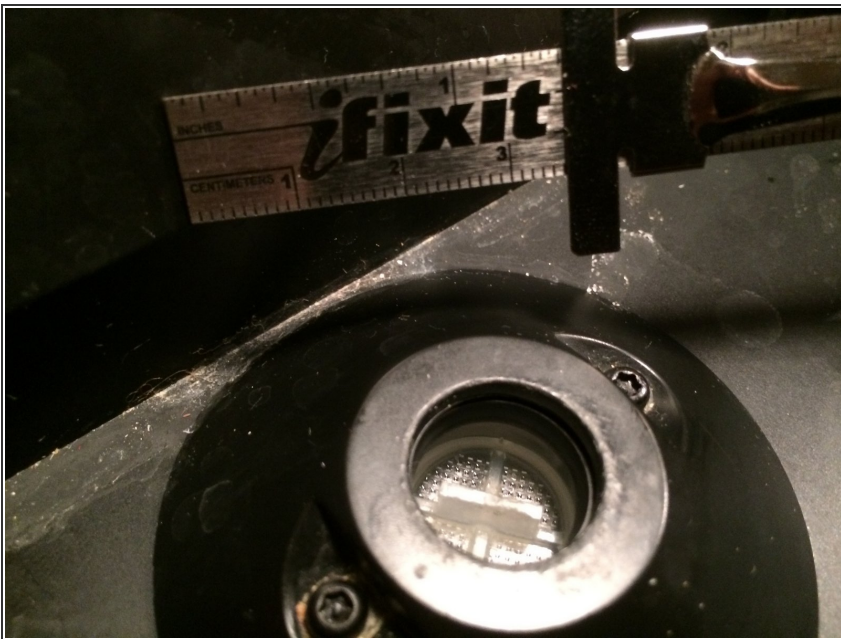

- Back together... And you are ready to make some coffee...

In case you notice the water seal rubber is broken or has tiny cuts in it. You can re-order part: MS-0907124 - Krups Seal

